


WS-AC exploded view

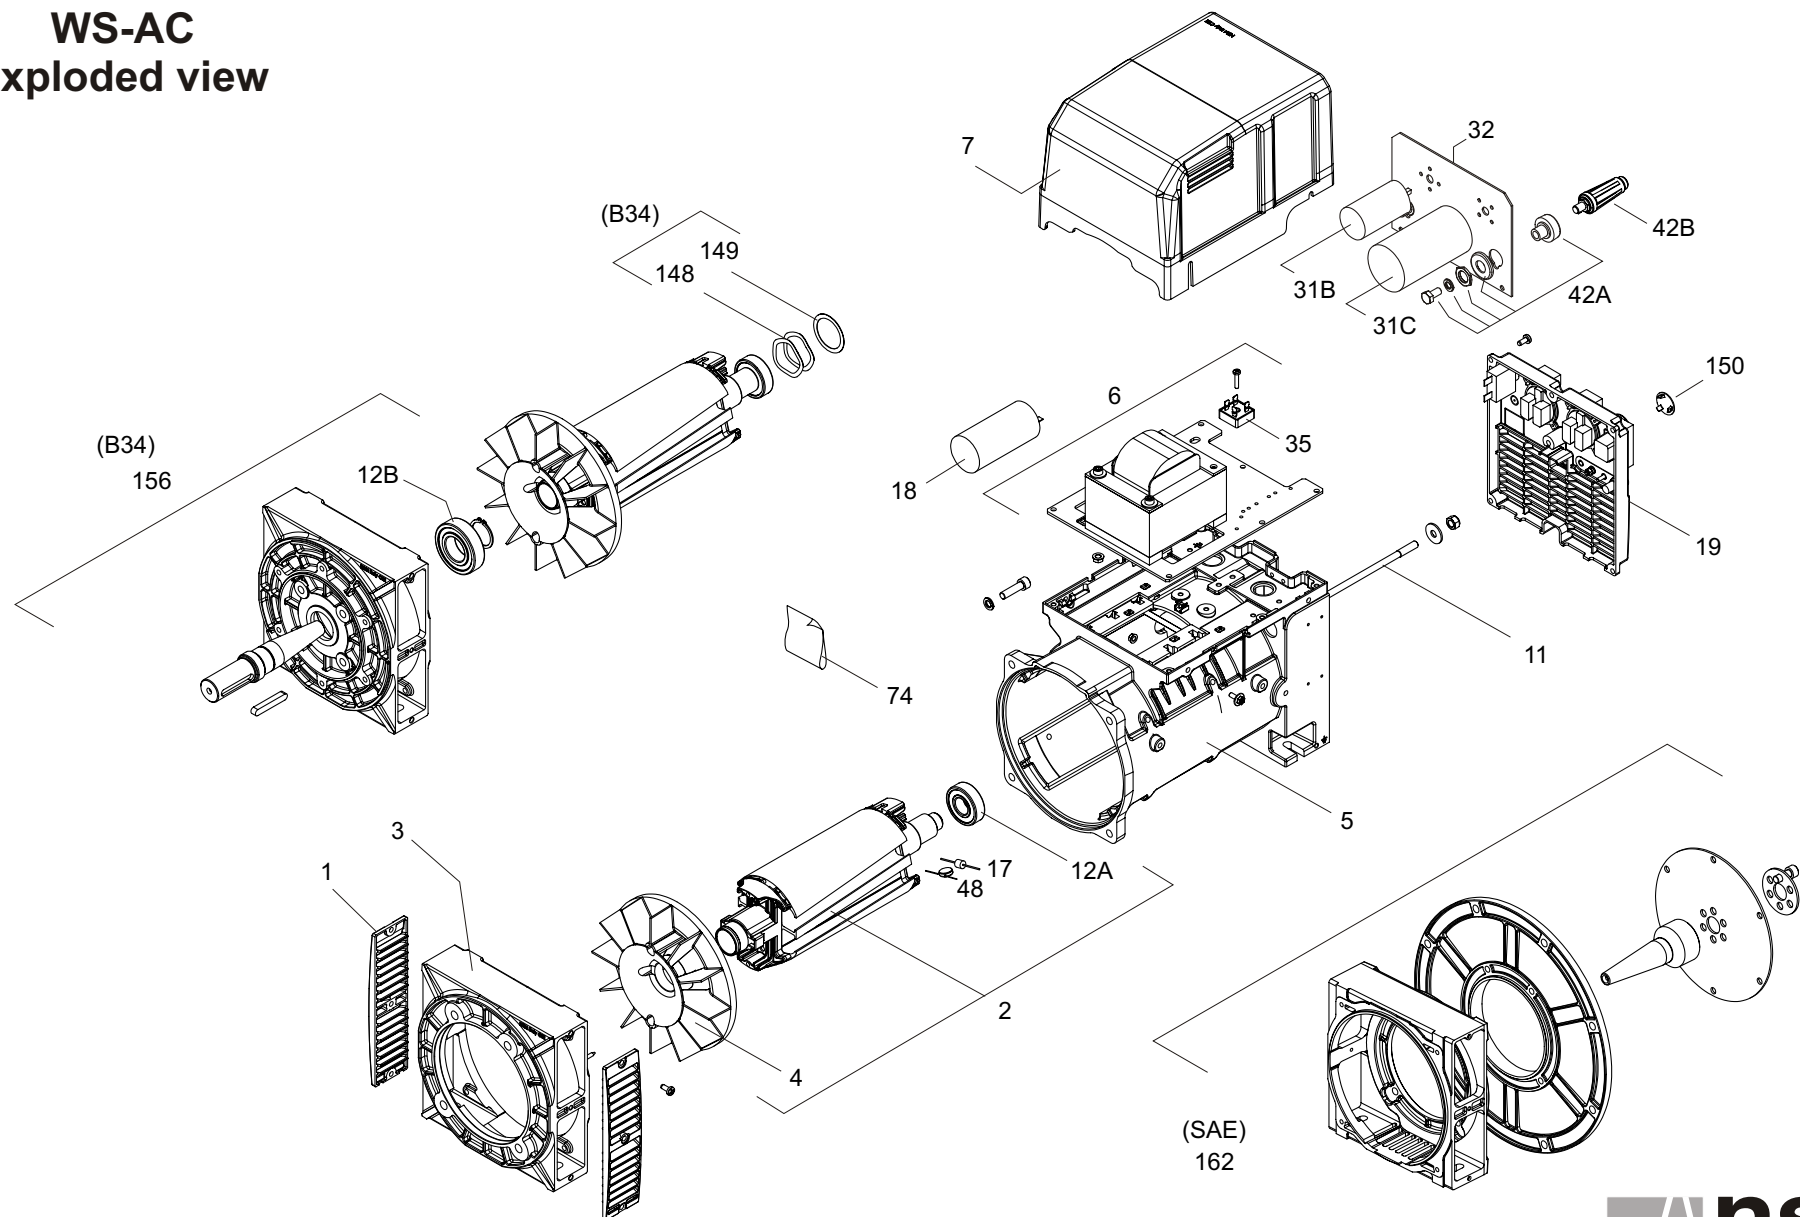

Lista Ricambi WS AC - WS AC Spare Parts List - Pièces Détachées WS AC

N.	q.ty	CODE	descrizione	description	description
1	2	1GGA10010	cuffia espulsione aria IP23	IP23 outlet grid	Grille de protection IP23
2	1	5AA1220--	Rotore avvolto completo WS 130AC (4-12A-17-48)	complete Wound rotor WS 130AC (with 4-12A-17-48)	Roue polaire bobiné complet WS 130AC (avec 4-12A-17-48)
2	1	5AA1220--	Rotore avvolto completo WS 180AC (4-12A-17-48)	complete Wound rotor WS 180AC (with 4-12A-17-48)	Roue polaire bobiné complet WS 180AC (avec 4-12A-17-48)
2	1	5AA1220--	Rotore avvolto completo WS 200AC (4-12A-17-48)	complete Wound rotor WS 200AC (with 4-12A-17-48)	Roue polaire bobiné complet WS 200AC (avec 4-12A-17-48)
2	1	5AA1220--	Rotore avvolto completo WS 140AC (4-12A-17-48)	complete Wound rotor WS 140AC (with 4-12A-17-48)	Roue polaire bobiné complet WS 140AC (avec 4-12A-17-48)
2	1	5AA1220--	Rotore avvolto completo WS 190AC (4-12A-17-48)	complete Wound rotor WS 190AC (with 4-12A-17-48)	Roue polaire bobiné complet WS 190AC (avec 4-12A-17-48)
2	1	5AA1220--	Rotore avvolto completo WS 220AC (4-12A-17-48)	complete Wound rotor WS 220AC (with 4-12A-17-48)	Roue polaire bobiné complet WS 220AC (avec 4-12A-17-48)
3	1	3SLA10012	scudo anteriore J609b C22-25,4-35	drive end bracket - J609b C22-25,4-35	Flasque avant - J609b C22-25,4-35
3	1	3SLA10013	scudo anteriore C23-30	drive end bracket - C23-C30	Flasque avant - C23-C30
3	1	3SLA10017	scudo anteriore B34	drive end bracket - B34	Flasque avant - B34
4	1	1VGA10003	ventola	fan	Ventilateur
5	1	5FA1209--	Carcassa avvolta WS 130AC	Wound frame WS 130AC	Carcasse bobiné WS 130AC
5	1	5FA1209--	Carcassa avvolta WS 180AC	Wound frame WS 180AC	Carcasse bobiné WS 180AC
5	1	5FA1209--	Carcassa avvolta WS 200AC	Wound frame WS 200AC	Carcasse bobiné WS 200AC
5	1	5FA1209--	Carcassa avvolta WS 140AC	Wound frame WS 140AC	Carcasse bobiné WS 140AC
5	1	5FA1209--	Carcassa avvolta WS 190AC	Wound frame WS 190AC	Carcasse bobiné WS 190AC
5	1	5FA1209--	Carcassa avvolta WS 220AC	Wound frame WS 220AC	Carcasse bobiné WS 220AC
6	1	5CA1204--	Gruppo impedenza completo WS 130AC (con [35])	complete impedance set WS 130AC (with [35])	Groupe reactance complet WS 130AC (avec [35])
6	1	5CA1204--	Gruppo impedenza completo WS 180AC (con [35])	complete impedance set WS 180AC (with [35])	Groupe reactance complet WS 180AC (avec [35])
6	1	5CA1204--	Gruppo impedenza completo WS 200AC (con [35])	complete impedance set WS 200AC (with [35])	Groupe reactance complet WS 200AC (avec [35])
6	1	5CA1204--	Gruppo impedenza completo WS 140AC (con [35])	complete impedance set WS 140AC (with [35])	Groupe reactance complet WS 140AC (avec [35])
6	1	5CA1204--	Gruppo impedenza completo WS 190AC (con [35])	complete impedance set WS 190AC (with [35])	Groupe reactance complet WS 190AC (avec [35])
6	1	5CA1204--	Gruppo impedenza completo WS 220AC (con [35])	complete impedance set WS 220AC (with [35])	Groupe reactance complet WS 220AC (avec [35])
7	1	1GGA10013	coperchio alto	High top cover	Couvercle haut

Lista Ricambi WS AC - WS AC Spare Parts List - Pièces Détachées WS AC

N.	q.ty	CODE	descrizione	description	description
11	1	7TZ---	Tirante rotore	rotor rod	Tige de roue polaire
12A	1	7CV62042R	Cuscinetto	ball bearing	Roulement
12B	1	7CV62062R	Cuscinetto per B34	Ball bearing for B34	Roulement pour B34
17	2	KDP6A12	Diodo rotore	rotor diode	Diode
18	1	7MEC045	Condensatore 45 µF 450V	Capacitor 45 µF 450V	Condensateur 45 µF 450V
18	1	7MEC050	Condensatore 50 µF 450V	Capacitor 50 µF 450V	Condensateur 50 µF 450V
18	1	7MEC055	Condensatore 55 µF 450V	Capacitor 55 µF 450V	Condensateur 55 µF 450V
19	1	1GGA10011	Cuffia aspirazione cieca	Blind cover	Couvercle arriere sans trous
31B	1	7MEI0005	Selettore corrente di saldatura	Welding current control selector	Selecteur de courant de soudage
31C	1	7MEI0002	Commutatore generatore/saldatrice	Generator/welder power switch	Commutateur alternateur/soudage
32	1	7TRRS10--	Pannello saldatrice	Welder plate	Plaque synoptique
35	1	KPD35A04	Ponte raddrizzatore per CB	B.C. rectifier bridge	Pont redresseur pour C.B.
42A	3	7MEP0006	Presa di saldatura	Welding socket	Prise de soudage
42B	2	7MES0001	Spina di saldatura	Welding plug	Fiche de soudage
48	2	KVZ14L781	Varistore	varistor	varistor
74	1	7ATSH10T	sacchetto viteria	assembling screw kit	Kit vis pour l'assemblage
148	2	7OC047	Anello compensazione (B34)	compensation ring (B34)	Bague de compensation (B34)
149	1	7OP04710	Anello di spessoramento (B34)	shimming ring (B34)	Bague(B34)
150	1	7PRTS0232	tappo di chiusura	plastic plug	Bouchon
156	1	7ATK110	Kit scudo B34 (con 12B)	Drive end bracket kit for B34 (with 12B)	Kit Flasque avant pour B34 (avec 12B)
162	1	3ATKSH---	Kit SAE	Kit SAE	Kit SAE

nella richiesta di parti di ricambio Vi preghiamo di comunicare sempre il tipo di alternatore/optional e le relative caratteristiche

On requesting of spare parts, please always indicate alternator/optional type and its characteristics

Nous vous prions d'indiquer toujours, dans vos commandes de pièces de rechanges, la description e les caracteristiques de la machine/optional